

Bulletin No: REF074
Date Issued: 14/03/2016
Reference No: EHR-445
Issued by: B. Nguyen

## SERVICE BULLETIN REFRIGERATOR

MODEL: SJF60PCSL/WH, SJF60PSSL, SJF60PVSL, SJF602SPSL/BK,

SJF65PCSL/WH, SJF65PSSL.

**SUBJECT:** Countermeasure for frozen damper

**GENERAL**: In some isolated cases there were some ice formed inside the damper gear box which cause the fridge operated out of specification.

**SYMPTOM:** Freezer too cold or fridge not cold.

CAUSE: Frozen damper.

**ACTION:** Please order the following 5 parts and fit them as per steps below:

ITEM	Description	Part Code			
		OLD	REPLACEMENT	Qty	Price code
	DAMPER ASS'Y	DTHM-A031CBKZ	DTHM-A031CBKZ	1	AX
	A-SEALER RC-D	PSEL-C669CBZZ	PSEL-C669CBZZ	1	AD
	A-SEALER RC-H	-	PSEL-E439CBZZ	1	AG
	A-SEALER RC-B B	-	PSEL-E465CBZZ	1	AK
	A-SEALER RC-B	PSEL-C563CBZZ	PSEL-C563CBZZ	1	AC

Note: The part code PSEL-C563CBZZ is the same however the thickness of the sealer is changed from 3mm to 5mm.


- 1) Please replace the damper assy part number DTHM-A031CBKZ because some water may remain inside the old damper assy.
- 2) Add sealer RC-D part number PSEL-C669CBZZ around the damper assy as per photo below:



**PRODUCTION CHANGE:** Improvement was implemented on mass production since March 2011.

SHARP CORPORATION of AUSTRALIA PTY. Limited

3) Add sealer RC-H part number PSEL-E439CBZZ around the damper assy to seal up any gap as per photo below:

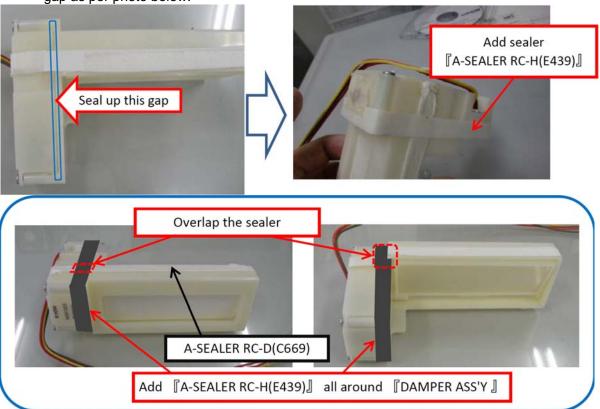

4) Add sealer RC-B part number PSEL-E465CBZZ on the slot of C-PART RF assy. Replace sealer RC-B part number PSEL-C563CBZZ with new thicker sealer as per photo below:

