

Bulletin No: REF059a
Date Issued: 06/08/2009
Reference No: EHR-304/343

REF059

Issued by: D.Safadi

## SERVICE BULLETIN REFRIGERATOR

MODEL: SJF65PC-SL/WH, SJF65PSSL, SJF60PC-SL/WH, SJF60PSSL, SJF60PVSL

**SUBJECT:** Change of parts – Lamp and Lamp Socket

**GENERAL:** The design of the interior lamp has been changed to allow the globe to be

purchased and replaced separately.

**EFFECTIVE:** From October 2007 – Supersedes Service Bulletin REF059 please replace

with this SiB

**ACTION:** Before ordering a replacement globe, check the serial number of the refrigerator

in Table 1 below to determine the correct part to order.


Please amend your Service Manuals to include these individual parts.


TABLE 1

Serial Number Range 0709XXXXX and below OLD				Serial Number Range 0710XXXXX and above NEW			
Ref no.	Description	Part number	Pric e code	Ref no.	Description	Part no.	Pric e code
1	Lamp ass'y(240V)	FLMP-A003CBZZ	AM	2	Lamp 15W(240V)	RLMP-A042CBZZ	AM
3	Lamp Socket			3	Lamp socket	QSOCAA096CBEZ	AK
4	Socket holder			4	Socket holder	LHLD-A785CBFA	AD
7	Reflect AL (65 type)			7	Reflect AL (65 type)	PSHEMA333CBPZ	AE
7	Reflect AL (60 type)			7	Reflect AL (60 type)	PSHEMA334CBPZ	AN
8	Lead Lamp	QCNW-B148CBZZ	AK	8	Lead Lamp	QCNW-B239CBZZ	AM
10	Warning Label			10	Warning Label	TLAB-A876CBRZ	AV
11	R-Louver (65 type)	MLOV-A050CBFA	AV	11	R-Louver (65 type)	MLOV-A050CBFA	AV
11	R-Louver (60 type)	MLOV-A051CBFA	AV	11	R-Louver (60 type)	MLOV-A051CBFA	AV
13	R Lamp Cover L (65 type)	PCOV-A332CBFA	AN	13	R Lamp Cover L (65 type)	PCOV-A382CBFA	AN
14	R Lamp Cover R (65 type)	PCOV-A333CBFA	AN	14	R Lamp Cover R (65 type)	PCOV-A383CBFA	AN
13	R Lamp Cover L (60 type)	PCOV-A335CBFA	AN	13	R Lamp Cover L (60 type)	PCOV-A384CBFA	AN
14	R Lamp Cover R (60 type)	PCOV-A336CBFA	AN	14	R Lamp Cover R (60 type)	PCOV-A385CBFA	AN
15	Screw Cover	LHLD-A715CBFA	AE	15	Screw Cover	LHLD-A715CBFC	AE

## **PRODUCTION CHANGE:**

Please note that the new and old parts are not interchangeable and care must be taken to ensure the correct part is ordered according to the serial number of the unit. **Customers** can replace the lamps <u>only</u> but the lamp socket will need to be replaced by a Service technician.

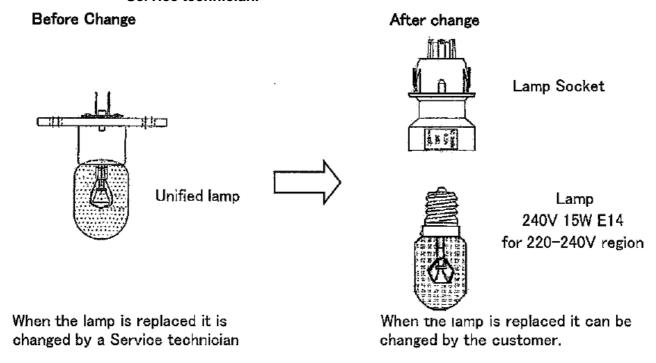

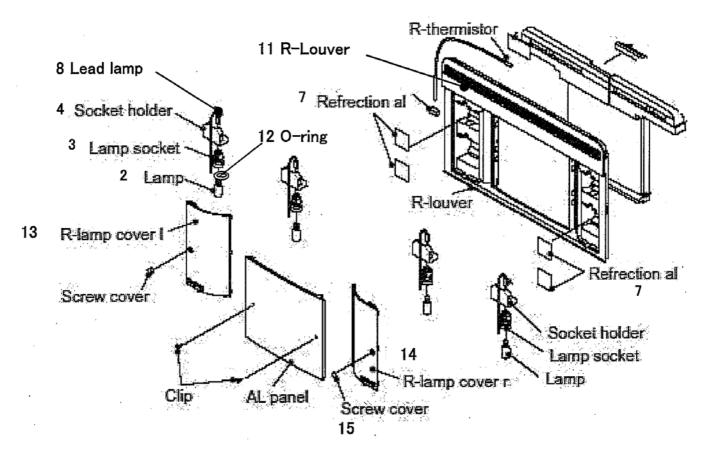

Please disregard item 12 O-ring as this is for Europe Models which use R600a gas.