Service Information

Panasonic

SI Number: SI-NR0005 Factory Ref: PAPTH1604005TE

Product:

Model(s): NR-BW415, NR-W465, NR-BY552, NR-CY557

Subject: Interior LED does not operate

Issue Date: 11th April 2016 Page: 1 of 2

Symptom: Interior LED does not operate normally

a. LED turns offb. LED dimsc. LED blinks

Counter


Measure: Replacement of LED PCB with kit

NR-BW415, There is only 1 LED lamp on the ceiling of the inner.

NR-BW465: Exchange both 1 LED PCB & Cover LED before Serial no :6xx4xxxxx(The

kit of 1 LED PCB and 1 cover is available.)

Model	Part Name	Part N°.	Contents of Kit
NR-BW415,	PAS-BW(LED PCB)-		LED PCB: 1 pcs
NR-BW465	Kits	CNRBG181513W	COVER LED LAMP: 1 pcs

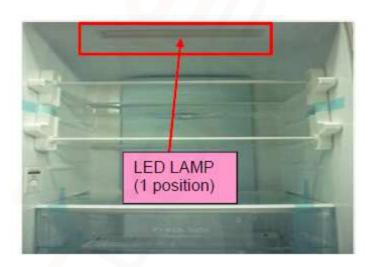

Service Information

Panasonic

SI Number: SI-NR0005 Factory Ref: PAPTH1604005TE

Product:

Model(s): NR-BW415, NR-W465, NR-BY552, NR-CY557


Subject: Interior LED does not operate

Issue Date: 11th April 2016 Page: 2 of 2

NR-BY552, Make sure to exchange 2 LED lamps together before Serial No. NR-CY54: 6xx4xxxxx. (The kit of 2 LED PCBs and 2 covers is available.)

Model	Part Name	Part N°.	Contents of Kit
NR-BY552,	PAS-BW(LED PCB)-		LED PCB: 2 pcs
NR-CY557	Kits	CNRBG181513Y	COVER LED LAMP: 2 pcs

NR-BY552

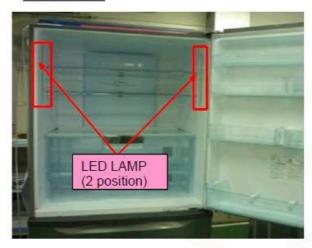

NR-CY557

